
CITY WIDE HOME INSPECTORS

PRE-LISTING HOME INSPECTION REPORT

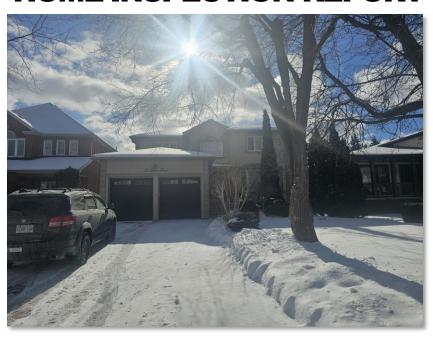

21 Lawrie Rd, Vaughan, Ontario

Report Number: 25020149

Inspection Date: 2025-02-07

Prepared by: City Wide Home Inspectors

PO Box 325

Tottenham, Ontario, L0G 1W0

Website: www.cwhi.ca

Inspector: Michael Fournier

Email: mike@cwhi.ca

Copyright © 2025 2061490 Ontario Inc. o/a City Wide Home Inspectors

City Wide Home Inspectors PO Box 325 Tottenham, Ontario, LOG 1W0 Phone: 416-831-6548

email: mike@cwhi.ca www.cwhi.ca



February 9, 2025

Inspection Address: 21 Lawrie Rd, Vaughan, Ontario

Report Number: 25020149

At your request, an inspection of the above property was performed on 2025-02-07. **City Wide Home Inspectors** is pleased to submit the enclosed report. This report is a professional opinion based on a visual inspection of the accessible components of the home. This report is not an exhaustive technical evaluation. An evaluation of this nature would cost many times more.

Please understand that there are limitations to this inspection. Many components of the home are not visible during the inspection and very little historical information is provided in advance of the inspection. While we can reduce your risk of purchasing a home, we cannot eliminate it, nor can we assume it. Even the most comprehensive inspection cannot be expected to reveal every condition you may consider significant to ownership. In addition to those improvements recommended in our report, we recommend that you budget for unexpected repairs. On average, we have found that setting aside roughly one percent of the value of the home on an annual basis is sufficient to cover unexpected repairs.

The Standards of Practice prohibits us from making any repairs or referring any contractors. We are not associated with any other party to the transaction of this property, except as may be disclosed to you.

The information provided in this report is solely for your use. **City Wide Home Inspectors** will not release a copy of this report without your written consent.

Thank you for selecting our company. We appreciate the opportunity to be of service. Should you have any questions about the general condition of the house in the future, we would be happy to answer these. There is no fee for this telephone or email consulting. Our fees are based on a single visit to the property. If additional visits are required for any reason, additional fees may be assessed.

Sincerely.

Michael Fournier, Owner City Wide Home Inspectors Certified Master Inspector, CMI Certified Mould Inspector, IAC2

Certified Commercial Property Inspector, CCPI Certified Infrared Camera Property Inspector, CICPI

BUILDING DATA

BUILDING DATA

Approximate Age: 30 to 50 yrs

Building Type: Single Family Detached

Building Style: Two Story General Appearance: Satisfactory

Main Entrance Faces: For the sake of this report North

Weather Condition: Overcast Temperature: Below 0 C

Ground cover: Snow/Ice Covered

Occupied Occupied

REPORT LIMITATIONS

This report is intended only as a general guide to help the client make his own evaluation of the overall condition of the home, and is not intended to reflect the value of the premises, nor make any representation as to the advisability of purchase. The report expresses the personal opinions of the inspector, based upon his visual impressions of the conditions that existed at the time of the inspection only. The inspection and report are not intended to be technically exhaustive, or to imply that every component was inspected, or that every possible defect was discovered. No disassembly of equipment, opening of walls, moving of furniture, appliances or stored items, or excavation was performed. This inspection is a limited visual examination of the readily accessible systems and components of the home only.

This inspection is conducted in compliance with the standards of practice of the International Association of Certified Home Inspectors (Inter-NACHI), a copy of which is available at www.citywidehomeinspectors.com/sop.

Systems and conditions which are not within the scope of the building inspection include, but are not limited to: pools spas or their related equipment, formaldehyde, lead paint, asbestos, toxic or flammable materials, and other environmental hazards; pest infestation, playground equipment, efficiency measurement of insulation or heating and cooling equipment, internal or underground drainage or plumbing, any systems which are shut down or otherwise secured; water wells (water quality and quantity) zoning ordinances; intercom; security systems; heat sensors; central vacuum systems, cosmetics or building code conformity. Any general comments about these systems and conditions are informational only and are not within the scope of this inspection.

The inspection report should not be construed as a compliance inspection of any governmental or non-governmental codes or regulations. The report is not intended to be a warranty or guarantee of the present or future adequacy or performance of the structure, its systems, or their component parts. This report does not constitute any express or implied warranty of merchantability or fitness for use regarding the condition of the property and it should not be relied upon as such. Any opinions expressed regarding adequacy, capacity, or expected life of components are general estimates based on information about similar components and occasional wide variations are to be expected between such estimates and actual experience. We recommend that any deficiencies noted in this report be repaired or corrected after consultation with reputable qualified contractors. It is suggested that more than one quote be obtained before commencing with repairs.

The sellers' property information sheet (SPIS) may be referred to in this document. This item is a statement that is often completed by the seller regarding the condition of the subject property. The buyer is urged to obtain and review this document, if available, as it contains crucial information. Photographs, taken at the time of this inspection, are to be considered part of this inspection report.

We certify that our inspectors have no interest, present or contemplated, in this property or its improvement and no involvement with tradespeople or benefits derived from any sales or improvements. To the best of our knowledge and belief, all statements and information in this report are true and correct.

We assume no liability for the cost of repair or replacement of unreported defects or deficiencies either current or arising in the future. You agree that in all cases our liability shall be limited to liquidated damages in an amount not greater than the fee you paid us. You waive any claim for consequential, exemplary, special or incidental damages or for the loss of the use of the home/building. You acknowledge that the liquidated damages are not a penalty, but that we intend them to (i) reflect the fact that actual damages may be difficult and impractical to ascertain; (ii) allocate risk between us; and (iii) enable us to perform the inspection for the agreed upon fee.

Should any disagreement or dispute arise as a result of this inspection or report, it shall be decided by arbitration and shall be submitted for binding, non-appealable arbitration unless the parties mutually agree otherwise. In the event of a claim, the Client will allow City Wide Home Inspectors to inspect the claim prior to any repairs or waive the right to make the claim. Client agrees not to disturb or repair or have repaired anything which may constitute evidence relating to the complaint, except in the case of an emergency.

Report Table of Contents

BUILDING DATA	3
REPORT LIMITATIONS	4
SUMMARY*	
GROUNDS	7
ROOF COVERING	8
CHIMNEY / GUTTERS / SIDING / TRIM	
EXTERIOR / ELECTRICAL / AC / GARAGE	10
KITCHEN	11
LAUNDRY	11
BATHROOMS	12
INTERIOR ROOMS	14
BASEMENT APARTMENT	17
KITCHEN	17
BEDROOM	19
LIVING ROOM	19
WINDOWS / FIREPLACES / ATTIC	20
BASEMENT	21
PLUMBING	22
HEATING SYSTEM	23
COOLING SYSTEM	24
ELECTRICAL	24
PHOTO GALLERY	25
GENERAL REMARKS	29
HOME MAINTENANCE SCHEDULE	41



ITEMS NOT OPERATING

None

MAJOR CONCERNS

None

POTENTIAL SAFETY HAZARDS

Visible apparent mould growth on drywall in furnace room Wiring improperly running thru metal stubs without gromets

DEFERRED COST ITEMS

Items that have reached or are reaching their normal life expectancy or show indications that they may require repair or replacement <u>anytime during the next five (5) years.</u>

Smoke detector over 5 years old

* Items listed in this report may inadvertently have been left off the Summary Sheet. Customer should read the entire report, including the Remarks.

DEFINITIONS

SATISFACTORY (Sat.) - Indicates the component is functionally consistent with its original purpose but may show signs of normal wear and tear and deterioration.

MARGINAL(Marg.) - Indicates the component will probably require repair or replacement anytime within five years.

POOR - Indicates the component will need repair or replacement now or in the very near future.

MAJOR CONCERNS - A system or component that is considered significantly deficient or is unsafe.

SAFETY HAZARD - Denotes a condition that is unsafe and in need of prompt attention.

GROUNDS

		0110011				
Service Walks		☑ None		☐ Public sidev	valk needs repai	ir
	☐ Concrete	☐ Flagstone		☐ Brick	□О	ther
Condition:	☐ Satisfactory	☐ Marginal		□ Poor	□ T 1	rip Hazard
	☐ Pitched towards home	☐ Settling cracks		☐ Not visible		
Driveway		□ None				
Directiay	☐ Concrete ☑ Aspl		ПР	Pavers	her	
Condition:	☑ Satisfactory	☐ Marginal		□ Poor		rip hazard
condition.	☐ Fill cracks and seal	☐ Pitched towards h	ome			ot visible
Datis/Lawsi						
Patio/Lanai		□ None		□ Datia Cta		41
Canditian.		lagstone □ Bi □ Marginal	rick	☐ Patio Sto☐ Poor		
Condition:	☐ Satisfactory ☐ Pitched towards home					rip Hazard ot visible
	☐ Pitched towards home	(See Kemarks page)		☐ Settling crack	.8 🖭 100	ot visible
Deck			Wood	1		
	☐ Treated	☐ Painted/Stained		☐ Railing/balus		
Condition:	☑ Satisfactory	☐ Marginal		□ Poor	\square N	ot visible
Deck/Patio/Por	ch Covers	☑ None ☐ I	Earth	to wood contact	☐ Moisture/	insect damage
Lacks:	☐ Metal straps/bolts/nai			er attachment to h		C
Porch (covered	entrance)	☑ None		☐ Railing/halı	usters recomm	ended
Support Pier:	□ Wood	☐ Concrete		□ Other		ot visible
Condition:	☐ Satisfactory	☐ Marginal		□ Poor		01 1151010
Floor:	☐ Satisfactory	☐ Marginal		□ Poor	□ Sa	afety Hazard
	<u> </u>		Wood			Other
Balcony (2nd fl Railing:	✓ Yes		w oou			
Condition:	☑ Satisfactory	☐ Marginal		☐ Railing/balus ☐ Poor		nueu afety Hazard
	L Saustactory					
Stoops/Steps		□ None		☐ Uneven rise		Safety Hazard
	☑ Concrete	□ Wood		☑ Other	☐ Railing re	
Condition:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Recommen	nd baluster
	☐ Cracked	☐ Settled		☐ Damaged wo	od	
Fencing		□ None		☐ Type:	I	Not evaluated
				V-1		
Landscaping Af	fecting Foundation	(See Remarks page)				
Negative grade at:	□ East □ West	□ North □ South		☑ Satisfactory		
	☐ Recommend additional	al backfill		☐ Recommend	window wells/c	overs
	☐ Trim back trees/shrub	beries		☐ Wood in cont	act/too close to	soil
	$\hfill\square$ Yard drains observed	- not tested		□ N/A		
Retaining Wall:	:	□ Yes		☑ No		
	☐ Concrete	□ Wood		☐ Other	☐ Safety Haz	zard
Visual Condition:		☐ Marginal		□ Poor	_ Surety 1100	
Hose Bibs	·	✓ Yes		□ No	☐ No anti-si	nhon valve
Operates:	□ Yes	□ No		☑ Not tested	□ Not on	phon varve
General Comm	ents					

Fencing is not part of a home inspection. General site drainage was properly sloping away from the house. Maintain a positive drainage slope away from the foundation. Review of the grounds and some of its related components was limited by snow covering.

ROOF COVERING

General Inform	ation						
Roof Visibility		Limited by	snow cover				
Inspected Fron	n	Ground with b	oinoculars				
Ctude of Doof							
Style of Roof	ination: Gable	 ☑ Hip	☐ Mansard	□ Shod	□ Flat	☐ Other	
· 1	ination:	□ Medium	☑ Steep	☐ Flat	□ Tat		
			Бъссер				
Roof Covering							
Type: Asphalt	Estimated Laye	ers: 1 layer	Approx	imate age of co	over: Not de	termined	
Ventilation Sys	etem						
Combination:	☑ Soffit	□ Ridge		☐ Gable		☑ Roof	
comomation.	□ Powered	□ Eaves		☐ Other		— 11001	
Eleching Meter	iol						
Flashing Mater Combination:	☐ Galv./Aluminum	☐ Asphalt	□ Lea	d □1	Rubber	☑ Not v	isible
Comomation.		☐ Other		ч 🗀 .	Kubbci	E NOL V	isioic
34 11 84 4 1 1							
		□ A cmb clt		ПСоппон		□ NI/A	
Combination:		☐ Asphalt ☐ Other		☐ Copper		□ N/A	
Copper Valley Material Combination: ☐ Galv./Aluminum ☐ Not visible Apparent Condition of the Following Roof Covering							
Condition:	☐ Curling	☐ Satisfac	tory	☐ Marginal			r
Condition:	☐ Moss Buildup	☐ Cupping ☐ Nail Popp	nin a	☐ Missing ta ☐ Ponding	bs/sningies/	⊞ Burn	Snots
	☐ Exposed Felt	☐ Other	mg	□ I olidilig		□ Duin	Spots
Ventiletien	F	(C D	-1	(C A 44°			
Ventilation		(See Rema	irks page)	(See Attic p	age)		
Flashings		☑ Not visi	ble □ S	atisfactory	☐ Margin	nal [] Poor
: .a.cgc	☐ Rusted		end Sealing	•	_		_ 1 001
Velleve					<u> </u>		
Valleys	☑ Not visible	☐ Satisfact	tory	☐ Marginal ☐ Rusted		□ P001	ŗ
	☐ Holes	□ Recomme	end Sealing	□ Kusteu			
	_ notes						
Skylights		☑ Yes	□ No	☑ Satisfacto	ory ⊔ M	larginal	□ Poor
Plumbing Vent	·s	☑ Yes	□ No	✓ Satisfacto	ory D M	larginal	□ Poor
. Idilibilig Velic		<u> </u>	L 110	ii banstach	лу <u>—</u> 1V1	iai giiiai	□ 1 001
General Comm	nents						
1		1					

Roof covering appeared in overall satisfactory condition at the time of the inspection. Review of the roof covering and some its related components was limited by snow covering.

CHIMNEY / GUTTERS / SIDING / TRIM

Chimney(s)			✓ None	Locatio	n(s):		
Viewed from:	□ Roof		☐ Ladder at	eaves	□ G ₁	ound w/binocula	ars
Chase:	□ Brick □ S	tone	☐ Metal	☐ Fr	amed	☐ Blocks	☐ Stucco
	Evidence of:	□ Cra	cked chimney	cap 🗆 Lo	ose mort	ar joints	☐ Loose brick
		☐ Hol	es in metal	□ Ru	st	☐ Flaking	
Flue:	☐ Tile	☐ Met	tal	☐ Unline	d	☐ Not visible	
	Evidence of:	□ Sca		☐ Cracks		☐ Creosote	
			ve flue(s) cleaned				ed (See Remarks page)
☐ Recommend of	cricket/saddle flash	ing		☐ Spark a	rrestor/r	ain cap recomme	ended
Gutters & Dow	/nspouts		☐ None	(See R	emarks j	page)	
☐ Insides need to	o be cleaned		☐ Ponding				
	☑ Galvanized/Ala	um.	☐ Copper		□ Vi	nyl	☐ Other
Condition:	☑ Satisfactory		☐ Marginal		□ Po		☐ Rusting
	☐ Hole in main r	un		Leaking:	□ Co	orners	☐ Joints
Extension needed:	□ North		☐ South		□ Ea	ıst	□ West
Siding							
Material:	Brick & Stucco						
Condition:	☑ Satisfactory		☐ Marginal	□ Po	or	□ Recommen	d repair/painting
Window Frame	es						
Material:	Mixed						
Condition:	☑ Satisfactory		☑ Marginal		\square Po	or	
	☑ Recommend pa	ainting	3		maged v	wood	
Trim, Soffit, Fa	ascia						
Trim Material:	Metal		Condition: S	Satisfactory			
Soffit Material:	Metal		Condition: S	Satisfactory			
Fascia Material:	Metal		Condition: S	Satisfactory			
Caulking							
Condition:	☑ Satisfactory		☐ Marginal		□ Po	oor	
	☐ Recommend ar	round v		/masonry le			trations
General Comn	nents						

Gutters were in overall adequate condition. Siding appeared to be in overall adequate condition. Trim appeared to be intact and in overall maintained condition.

EXTERIOR / ELECTRICAL / AC / GARAGE

Exterior Wall C	onetruction							
Construction Style		1 Satist	factory \square	Marginal	□ Poor			
Exterior Doors			☑ Entra	ance (1);	Storm (2)); Patio (3)		
Weather stripping:	☑ Satisfactory		☐ Margi	nal		l Poor		
Condition:	☑ Satisfactory		☐ Margi	nal		l Poor		
Exterior Electri	cal Service							
	☐ Overhead	☑ Un	derground	Servic	e drop:	☐ Satisf	actory	☐ Needs service
Exterior outlets:	☑ Yes	□ No		Opera	ıte:	✓ Yes		□ No
GFCI protected:	☑ Yes	□ No		Opera	ıte:	✓ Yes		□ No
Reverse polarity:	□ Yes	☑ No		Open	ground:	☐ Yes		☑ No
Overhead wires:	□ Low □	Less tl	nan 1 meter	from balco	ny/deck/	window \square E	xtension	cord/exposed Romex
Potential safety	hazard:	☐ Yes	S	☑ No	(\$	See Remarks	page)	-
A/C Condenser/	Heat Pump		□ None	Approxi	mate age:	: 1 to 5 yrs		
#1 Brand: Colen	nan							Shutoff: Yes
Condition:	☑ Satisfactory	□ Ma	rginal	□ Poor	□ Rus	sted/dirty	Level:	☑ Yes □ No
Garage								
Garage Type:	Attached		ge Size: Do					
Automatic open		-	ational: Yes					
Safety reverse: I		□ No	1	: □ Yes		☑ Needs adj		☐Safety Hazard
Electric sensor:		□ No		: ☑ Yes	□ No	☐ Too low		□Safety Hazard
Floor:	☑ Concrete		☐ Grave			l Asphalt		☐ Dirt
	Burners less than				1 N/A □			Safety hazard
	Condition:		isfactory		pical crac			
Overhead door:	□ Wood		erglass	□ Ma	sonite	✓ Metal		☐ Other
	Condition:		isfactory	□ Ma	rginal	☐ Poor	□ Rep	oair, replace, paint
Service door:	☑ Satisfactory	□ Ma		□ Poo		□ None		
Sill plates:	☐ Elevated	☐ Flo	or level	☐ Bot	th	☑ Not v		☐ Rotted
Electricity prese		□ No		rotected:				☑ Yes □ No
	Reverse polarity/o			es 🗆 Saf	ety Haza	ard 🗹 No		lyman/ext. cord wiring
Firewall:	(Between garage	& livir	ng area)	□ N/A		1 Present	☐ Miss	ing □ Damaged
Fire door:	☐ Not verifiable			□ Nee	eds repair		•	
Auto closure:	□ N/A	☑ Sat	isfactory		□ Inop	perative \square	Missing	☐ Needs repair
General Comm	nents							

Doors were reviewed and found to be in working order. Lights appeared to be in normal condition: not all lights were tested. Exterior outlets tested were in normal working order.

KITCHEN

Countertops			☑ Satisfa	ctory	☐ Marg	ginal	□ Poor
Cabinets							
Condition:	☑ Satisfactory		☐ Margina	1 L	□ Poor	⊔ Reco	mmend repairs
Plumbing Com							
Faucet leaks:	□ Yes	☑ No		ipes leak/corrod		Yes	☑ No
Drainage:	☑ Adequate	□ Poo	r V	Vater pressure:	✓	Adequate	□ Poor
Walls & Ceiling							
Condition	☑ Satisfactory	☐ Mar	ginal	□ Poor		Typical cracks	☐ Moisture stains
Heat Source P	resent		☑ Yes	□ No			
Floor							
Condition	☑ Satisfactory	☐ Mar	ginal	□ Poor		Sloping	☐ Squeaks
Appliances			(See Rem	arks page)			
Dishwasher:	☑ Yes	□ No		Operates:		Yes	\square No \square N/A
Range:	✓ Yes	□ No		Operates:		Yes	□ No □ N/A
Oven:	☑ Yes	□ No		Operates:		Yes	\square No \square N/A
Exhaust fan:	☑ Yes	□ No		Operates:	_	Yes	\square No \square N/A
Refrigerator:	☑ Yes	□ No		Operates:	_	Yes	□ No □ N/A
Other:	☐ Yes	□ No		Operates:		Yes	□ No □ N/A
Electrical							
Outlets present:	☑ Yes	□ No		Operates:	$\overline{\checkmark}$	Yes	□ No
GFCI protected:	☐ Yes	☑ No		Operates:		Yes	☐ No (Remarks)
Open ground/rev	erse polarity with	in 1 met	er of water:	☐ Yes ☐ Sat	fety Haz	ard ☑ No	
General Comm	nents:						
	ormal wear. Cabi		mly tested and				lrain leaks at the
			LAU	MUKI			
Cross connection		✓ Non	e apparent	Uaat source pr	rocont:	☑ Yes	□ Not Visible
Room appears ve			e apparem Windov	Heat source pr w □ Not vis		E 168	□ INOU VISIBLE
Dryer vented:	□ N/A		☑ Wall	W ☐ Not vis		Not vented	
•	ground/reverse pola					etv Hazard	☑ No
Appliances prese			In Timeter of w ☑ Dryer	Water heate		Furnace	☐ Other
Gas pipe:	✓ N/A		shutoff:	□ Yes □		Cap Needed	☐ Safety Hazard
General Comm	nents						

At the time of the inspection the laundry facilities were in satisfactory condition.

BATHROOMS

Bath: Primary	Bedroom					
Sinks	Faucet leaks:	□ Yes	☑ No		Pipes leak:	☐ Yes ☑ No
Tubs	Faucet leaks:	□ Yes	☑ No		Pipes leak:	☐ Yes ☑ No
Showers	Faucet leaks:	□ Yes	☑ No		Pipes leak:	☐ Yes ☑ No
Toilet:	Bowl loose	□ Yes	☑ No	<i>Operates</i> : ✓ Yes	☐ No ☐ Cracked b	
Whirlpool:	201110050	✓ Yes	□ No	Operates: ✓ Yes	□ No	
Shower/Tub area	•			☐ Fiberglass	☐ Masonite	☐ Other
	Condition:	✓ Satisfa		☐ Marginal	□ Poor	☐ Rotted floors
	Caulk/Grouting r		☐ Yes	☑ No	Where:	in itolica moors
Drainage:	✓ Satisfactory	iceaea.	☐ Margin		□ Poor	
Water flow:	✓ Satisfactory		☐ Margin		□ Poor	
Moisture stains p		□ Walls	☐ Ceiling		_ 1 001	
Outlets present:			C	ted: ☑ Yes □ No	Operates: 🗹 Y	Zes □ No
Oddets present.	Open ground/rev				☐ Yes ☑ No	103 🗖 110
	Potential safety				e Remarks page)	
Heat source prese	<u> </u>	Yes	escii.		c Remarks page)	
Exhaust fan:			Operates:	☑ Yes	□ No □ Nois	V
Windows:				glass □ None □ Ev		
Door:				Does not latch \square H		
		□ 1 001 L	1 Holes L	Does not laten 🗀 i	iaidwaic blokeli L	1 None
General Comm	nents					
noted. Bath: Second 1	floor				•	
Sinks	Faucet leaks:	☐ Yes	☑ No		Pipes leak:	☐ Yes ☑ No
Tubs	Faucet leaks:	□ Yes	☑ No		Pipes leak:	☐ Yes ☑ No
Showers	Faucet leaks:	□ Yes	☑ No		Pipes leak:	☐ Yes ☑ No
Toilet:	Bowl loose	□ Yes	☑ No	Operates: ☑ Yes	☐ No ☐ Cracked b	
Whirlpool:	D 0 W1 1005 C	□ Yes	☑ No	Operates: ☐ Yes		John L Tonet leans
Shower/Tub area	•			☐ Fiberglass	☐ Masonite	☐ Other
	Condition:	✓ Satisfac		☐ Marginal	□ Poor	☐ Rotted floors
	Caulk/Grouting r		☐ Yes	☑ No	Where:	in itolica moors
Drainage:	✓ Satisfactory		✓ Margin		□ Poor	
Water flow:	✓ Satisfactory		☐ Margin		□ Poor	
Moisture stains p		□ Walls	☐ Ceiling		1 1 001	
	✓ Yes □			ted: ☑ Yes □ No	Operates: 🔽 🗎	Zes □ No
outlets present.	Open ground/rev				☐ Yes ☑ No	200 = 110
	Potential safety			☐ Yes ☑ No (Se		
Heat source prese	•	Yes			puge)	
Exhaust fan:			Operates:	☑ Yes	□ No □ Nois	V
Windows:					idence of leaking ins	•
Door:						
Door: General Comm	☑ Sat. ☐ Marg.			Does not latch		

At the time of the inspection, the bathroom and its components were found to be in satisfactory condition except as noted. Both the left side sink and bathtub have slow drains, have reviewed and corrected as necessary.

Bath: Main floo	r						
	Faucet leaks:	☐ Yes	☑ No			Pipes leak:	☐ Yes ☑ No
Toilet:	Bowl loose	☐ Yes	☑ No	Operates:	✓ Yes	☐ No ☐ Cracked 1	bowl ☐ Toilet leaks
Drainage:	☑ Satisfactory		☐ Margina	al		□ Poor	
Water flow:	☑ Satisfactory		☐ Margina	al		□ Poor	
Moisture stains pr	resent:	☐ Walls	☐ Ceiling	s 🗹 No			
Outlets present:	☑ Yes □ No	GFCI prote	ected:	☑ Yes	□ No	Operates:	☑ Yes □ No
	Open ground/reve	erse polarity	within 6'	of water:	☐ Yes	☑ No	
	Potential safety l	nazards pr	esent:	☐ Yes	☑ No	(See Remarks pag	ge)
Heat source prese	nt:	☑ Yes		□ No			
Exhaust fan:	☑ Yes □	No O_{i}	perates:	☑ Yes		□ No □ Nois	sy
Door:	☑ Sat. ☐ Marg.	□ Poor □	Holes \square	Does not lat	tch 🗆 H	Iardware broken	☐ None
General Comm	ents						
At the time of the noted.	inspection, the ba	throom and	l its compo	nents were	found to	be in satisfactory co	ondition except as
Bath: Basemen	nt						
Sinks	Faucet leaks:	☐ Yes	☑ No			Pipes leak:	☐ Yes ☑ No
Showers	Faucet leaks:	☐ Yes	☑ No			Pipes leak:	☐ Yes ☑ No
Toilet:	Bowl loose	☐ Yes	☑ No	Operates:	✓ Yes	☐ No ☐ Cracked I	bowl Toilet leaks
Shower area:	☑ Ceramic/Plasti		☐ Fibergla	ass		☐ Masonite	☐ Other
	Condition:	☑ Satisfac		☐ Margina	al	□ Poor	☐ Rotted floors
	Caulk/Grouting n	eeded:	☐ Yes	☑ No		Where:	
Drainage:	☑ Satisfactory		☐ Margina			□ Poor	
Water flow:	☑ Satisfactory		☐ Margina			□ Poor	
Moisture stains pr		☐ Walls					
Outlets present:				ted: 🗆 Yes		Operates: 🗹 🛚	Yes □ No
	Open ground/reve					☐ Yes ☑ No	
	Potential safety l		esent:	☐ Yes ☑ I	No (See	e Remarks page)	
Heat source prese	nt:	Yes		□ No			
Exhaust fan:			perates:	☐ Yes		□ No □ Nois	2
Windows:						dence of leaking in	
Door:	☑ Sat. ☐ Marg.	□ Poor □	Holes	Does not lat	tch 🗆 H	Iardware broken	☐ None
General Comm	ents						

Recommend the addition of an exhaust fan vented to the exterior of the home to improve ventilation in the home and prevent moisture build up especially in the winter months. Outlets within 3 feet of the sink should be considered for upgrading to GFCI protected outlets.

INTERIOR ROOMS

PRIMARY BE	DROOM						
Location: Seco	nd floor						
Walls & Ceiling:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Typical (Cracks	☐ Holes
J					71		
Flooring:					☐ Squeaks		☐ Slopes
	_				— 1		
Moisture stains: Yes							
Walls & Ceiling: Satisfactory							
Heat source prese		•		y 11uzuru	_ 1,0	_ 0010	210 1111001119
-			□ None l	□ Evidence of	leaking incu	lated ala	cc
							35
						NOIL	
Closet Doors.	□ Sat. □ Marg. □ FOC	I LI Holes LI Miss	ning 🗀 i	iacks blokell i	LI None		
General Comm	ents:						
At the time of the	inspection the room was	found to be in over	rall satisf	actory condition	n.		
	-			•			
PEDDOOM #	,						
	Coation: Second floor						
Walls & Ceiling:	•	_			☐ Typical (Cracks	☐ Holes
					☐ Squeaks		
	☑ N/A	□ Satisfactory		☐ Marginal			
Electrical:					Operates:		
	Open ground/reverse pol	larity: □ Yes	☐ Safet	y Hazard	☑ No	□ Cove	ers missing
Windows:	☑ Sat. ☐ Marg. ☐ Poo	or \square Cracked glass	\square None l	☐ Evidence of	leaking insu	lated gla	SS
Door:	☑ Sat. ☐ Marg. ☐ Poo	or 🗆 Holes 🗀 Does	not latch	n □ Hardware	e broken 🛚	None	
Closet Doors:	☑ Sat. ☐ Marg. ☐ Poo	or 🗆 Holes 🗀 Miss	sing 🗆 T	racks broken 1	□ None		
Canaral Camp	onto.						
General Comin	erits:						
A		C 1. 1 :	11 6	. 11			
At the time of the	inspection the room was	found to be in over	rall satisfi	actory condition	on.		
BEDROOM #3	3						
Location: Seco	nd floor						
Walls & Ceiling:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Typical (Cracks	☐ Holes
		-			71		
Flooring:					☐ Squeaks		☐ Slopes
					— 1		
		•	√ Yes	-	Operates:		
Electrical.							ers missing
Heat source prese		visible	_ 5000	,	_ 110	_ 2010	
Windows:	☑ Sat. ☐ Marg. ☐ Poo		□ None	□ Evidence of	f leaking inc	ilated old	155
Door:	✓ Sat. ☐ Marg. ☐ Poo						400
Closet Doors:	☑ Sat. ☐ Marg. ☐ Pool					1 10110	
Ciosei Doois.	ш заг. ш marg. ш Poc	л ш Holes ш IVIIS	anig 🗀 i	TACKS DIOKEII	□ INOILE		
General Comm	onts:			<u> </u>			

BEDROOM #4	4						
Location: Seco	nd floor						
Walls & Ceiling:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Typical (Cracks	☐ Holes
	Moisture stains:	☐ Yes		☑ No			
Flooring:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Squeaks		\square Slopes
Ceiling fan:	☑ N/A	□ Satisfactory		☐ Marginal		☐ Poor	
Electrical:	Switches: ✓ Yes ✓		☑ Yes		Operates:	☑ Yes	
	Open ground/reverse po	•	☐ Safet	y Hazard	☑ No	☐ Cove	rs missing
Heat source prese		t visible					
Windows:	☑ Sat. ☐ Marg. ☐ Poo						SS
Door:	☑ Sat. ☐ Marg. ☐ Poo					None	
Closet Doors:	☑ Sat. ☐ Marg. ☐ Poo	or ⊔ Holes ⊔ Miss	sing ⊔ T	Tracks broken	□ None		
General Comm	ients:						
A		C 1 . 1 .	11 6				
At the time of the	e inspection the room was	s found to be in over	all satisfa	actory condition	on.		
LIVING ROOI							
Location: First							
Walls & Ceiling:	•	☐ Marginal		□ Poor	☐ Typical (Cracks	☐ Holes
	Moisture stains:	☐ Yes		☑ No			
Flooring:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Squeaks		☐ Slopes
Ceiling fan:	☑ N/A	□ Satisfactory		☐ Marginal		□ Poor	
Electrical:	Switches: ✓ Yes ✓	No Outlets:	✓ Yes	□ No	Operates:	☑ Yes	□ No
	Open ground/reverse po		☐ Safety	y Hazard	☑ No	□ Cove	rs missing
	ent: ☑ Yes ☐ Not vis						
Windows:	☑ Sat. ☐ Marg. ☐ Po						
Door:	□ Sat. □ Marg. □ Po	or \square Holes \square Does	s not latel	h 🛮 Hardwar	e broken 🗹	None	
General Comm	nents:						
At the time of the	e inspection the room was	s found to be in over	all satisfa	actory conditio	on.		
110 010 011110 01 011	mspection are room was		uii suuisi	actory condition			
DINING ROO	М						
Location: First							
		□ Manainal		□ Door	□ Tropical (Cmaalsa	
Walls & Ceiling:		☐ Marginal		□ Poor	☐ Typical (Cracks	☐ Holes
Election	Moisture stains:	☐ Yes		☑ No □ Poor	□ Causalra		□ Clores
Flooring:	☑ Satisfactory	☐ Marginal			☐ Squeaks		☐ Slopes
Ceiling fan:	☑ N/A	☐ Satisfactory	□ V	☐ Marginal	0	□ Poor	□ Na
Electrical:	Switches: ✓ Yes ✓			□ No	Operates:	☑ Yes	
TT 4	Open ground/reverse po		□ Saret	y Hazard	☑ No	□ Cove	rs missing
Heat source prese				C1 1:			
Windows:	☑ Sat. ☐ Marg. ☐ Po						
Door:	□ Sat. □ Marg. □ Po	or \square Holes \square Doe	s not late	n 🗀 Hardwai	re broken ⊻	u inone	
General Comm	ents:						
A 1		C 1. 1 .	11	. 11.1			

FAMILY ROO	M						
Location: First	floor						
Walls & Ceiling:		☐ Marginal		□ Poor	☐ Typical	Cracks	☐ Holes
	Moisture stains:	☐ Yes		☑ No			
Flooring:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Squeaks		\square Slopes
Ceiling fan:	☑ N/A	□ Satisfactory		☐ Marginal		□ Poor	
Electrical:	Switches: ✓ Yes ☐		☑ Yes		Operates:		
	Open ground/reverse po		☐ Safet	y Hazard	☑ No	□ Cove	ers missing
	ent: ☑ Yes ☐ Not vi						
Windows:	☑ Sat. ☐ Marg. ☐ Po						
Door:	□ Sat. □ Marg. □ Po	oor 🗆 Holes 🗆 Doe	s not late	ch □ Hardwa	re broken 🛭	I None	
General Comm	nents:						
		•					
At the time of the	e inspection the room was	s found to be in over	all satisfa	actory conditio	n.		
EATING ARE	A						
Location: First	floor						
Walls & Ceiling:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Typical	Cracks	☐ Holes
C	Moisture stains:	□ Yes		☑ No	71		
Flooring:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Squeaks		☐ Slopes
Ceiling fan:	☑ N/A	☐ Satisfactory		☐ Marginal	•	□ Poor	-
Electrical:	Switches: ✓ Yes □	•	☑ Yes	_	Operates:	☑ Yes	□ No
	Open ground/reverse po		☐ Safet	y Hazard	No	□ Cove	ers missing
Heat source prese	ent: ☑ Yes ☐ Not vi		•	•			C
Windows:	☑ Sat. ☐ Marg. ☐ Po		□ Evid	ence of leaking	g insulated g	lass	
Door:	☑ Sat. ☐ Marg. ☐ Po						
General Comm	nents:						
Gerierai Goriiii	ionto.	ı					
At the time of the	e inspection the room was	s found to be in over	all satisfa	actory conditio	n.		
	1			,			
REC ROOM							
Location: Base:	ment						
Walls & Ceiling:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Typical	Cracks	☐ Holes
	Moisture stains:	□ Yes		☑ No	• •		
Flooring:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Squeaks		☐ Slopes
Ceiling fan:	☑ N/A	☐ Satisfactory		☐ Marginal	•	□ Poor	
Electrical:	Switches: ✓ Yes □		Yes		Operates:	☑ Yes	□ No
	Open ground/reverse po		☐ Safet	y Hazard	No		ers missing
Heat source prese				-			Č
Windows:	□ Sat. □ Marg. □ Po	oor Cracked glass	□ Evid€	ence of leaking	insulated gl	ass	
General Comm	 nents:						

Subject Property: 2	r Lawrie Ra, vaugi	nan, Ontar	10						Page 17
BASEMENT	ROOM								
Location: Base									
Walls & Ceiling:			☐ Margina	al	□ Po		☐ Typical	Cracks	☐ Holes
Flooring: Ceiling fan:	✓ Satisfactory ✓ N/A		☐ Yes ☐ Margina ☐ Satisfac		☑ No □ Po		☐ Squeaks	□ Poor	□ Slopes
Electrical:		Yes □ l verse pol	No Out	lets: ☑ Yes	□ No		<i>Operates</i> : ☑ No	☑ Yes	□ No ers missing
Heat source pres		Not vis			•				
Windows:	☑ Sat. ☐ Mar	g. 🗆 Poo	or 🗆 Cracked	l glass 🛮 Evid	ence of	leaking	insulated gl	ass	
General Comn	nents:								
At the time of the	e inspection the r	oom was	found to be i	in overall satisf	factory	condition	ı .		
	•				•				
	B	ASE	MENT	T APAF	SLV	JEN	Т		
							-		
			KIT	CHEN					
Countertops			☑ Satisfa	actory	⊔N	I arginal		□ Poo	r
Cabinata									
Cabinets Condition:	☑ Satisfactory		☐ Margina	a1	□ Po	~ *	□ Dogg	mmend	ronoire
Condition.	☑ Satisfactory		□ Margina	a1 		Л	□ Kecc	Jillillellu	repairs
Plumbing Con									
Faucet leaks:	□ Yes	☑ No		Pipes leak/corre		☐ Yes		☑ No	
Drainage:	☑ Adequate	□ Poo	r '	Water pressure	:	☑ Adec	luate	□ Poor	
Walls & Ceiling	 g								
Condition	☑ Satisfactory	☐ Mar	ginal	□ Poor		☐ Typi	cal cracks	☐ Mois	ture stains
Heat Source P	resent		✓ Yes	□ No					
ricat oodice i	i cociii		L 103	— 110					
Floor									
Condition	☑ Satisfactory	☐ Mar	ginal	□ Poor		□ Slopi	ing	☐ Sque	aks
								- ~ 1	
Appliances			(See Ren	narks page)		□ x7			□ 37/A
Dishwasher:	□ Yes	☑ No		Operates:		☐ Yes		□ No	□ N/A
Range:	☑ Yes	□ No		Operates:		☑ Yes		□ No	□ N/A
Oven:	☑ Yes	□ No		Operates:		☑ Yes		□ No	□ N/A
Exhaust fan:	☑ Yes	□ No		Operates:		☑ Yes		□ No	□ N/A
Refrigerator:	☑ Yes	□ No		Operates:		☑ Yes		□ No	□ N/A
Other:	□ Yes	□ No		Operates:		☐ Yes		□ No	□ N/A
Electrical									
Outlets present:	☑ Yes	□ No		Operates:		☑ Yes		□ No	
GFCI protected:		☑ No		Operates:		□ Yes			Remarks)
	erse polarity with		er of water:	□ Yes			y Hazard	☑ No	/

Counter top has normal wear. Cabinets have normal wear. Water flow was normal with several fixtures operated at the same time. There were no visible active piping leaks at the time of the inspection. Drain lines had no visible leaks or signs of backup at the time of inspection. Outlets were randomly tested and had correct polarity, except as noted.

General Comments:

BATHROOM

Sinks	Faucet leaks:	☐ Yes	☑ No		Pipes leak:	☐ Yes ☑ No	
Showers	Faucet leaks:	☐ Yes	☑ No		Pipes leak:	☐ Yes ☑ No	
Toilet:	Bowl loose	☐ Yes	☑ No	<i>Operates</i> : ✓ Yes	☐ No ☐ Cracked b	owl Toilet leaks	
Shower area:	☑ Ceramic/Plast	ic	☐ Fibergl	ass	☐ Masonite	☐ Other	
	Condition:	✓ Satisfae	ctory	☐ Marginal	□ Poor	☐ Rotted floors	
	Caulk/Grouting 1	needed:	☐ Yes	☑ No	Where:		
Drainage:	☑ Satisfactory		☐ Margin	al	□ Poor		
Water flow:	☑ Satisfactory		☐ Margin	al	□ Poor		
Moisture stains p	resent:	\square Walls	☐ Ceiling	s 🗹 No			
Outlets present:	☑ Yes □	No C	GFCI protec	eted: ☐ Yes ☑ No	Operates: 🗹 Y	es □ No	
	Open ground/rev	erse polarit	ty within 1 i	meter of water:	☐ Yes ☑ No		
Potential safety hazards present: \square Yes \square No (See Remarks page)							
Exhaust fan:	□ Yes ☑	No (Operates:	☐ Yes	□ No □ Nois	у	
Windows:	☑ Sat. ☐ Marg.	□ Poor	□Cracked g	glass □ None□ Evi	dence of leaking ins	ulated glass	
Door:	☑ Sat. ☐ Marg.	□ Poor	□ Holes □	Does not latch	Hardware broken [☐ None	
General Comm	General Comments						

Recommend the addition of an exhaust fan vented to the exterior of the home to improve ventilation in the home and prevent moisture build up especially in the winter months. Outlets within 3 feet of the sink should be considered for upgrading to GFCI protected outlets.

BEDROOM

Walls & Ceiling:	☑ Satisfactory	☐ Marginal		□ Poor	☐Typical (Cracks	☐ Holes
	Moisture stains:	☐ Yes		☑ No			
Flooring:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Squeaks		\square Slopes
Ceiling fan:	☑ N/A	□ Satisfactory		☐ Marginal		□ Poor	
Electrical:	Switches: ✓ Yes ☐		✓ Yes		Operates:		□ No
	Open ground/reverse po		□Safety	y Hazard	☑ No	□ Cove	ers missing
Heat source pres		t visible	_				
Windows:	☐ Sat. ☐ Marg. ☐ Po						ass
Door:	☑ Sat. ☐ Marg. ☐ Po	oor 🗆 Holes 🗆 Do	es not late	ch 🗆 Hardwa	re broken [☐ None	
General Comn	nents:						
		_					
At the time of the	e inspection the room wa	s found to be in over	rall satisf	actory condition	n.		
	· · · · · · · · · · · · · · · · · · ·			,			
			DOC	N //			
		LIVING	KUL	<i>)</i> IVI			
Walls & Ceiling:	☑ Satisfactory	☐ Marginal		□ Poor	☐Typical (Cracks	☐ Holes
	Moisture stains:	□ Yes		☑ No			
Flooring:	☑ Satisfactory	☐ Marginal		□ Poor	☐ Squeaks		\square Slopes
Ceiling fan:	☑N/A	□ Satisfactory		☐ Marginal		□ Poor	
Electrical:	Switches: ✓ Yes ☐	No Outlets:	✓ Yes	□ No	Operates:	✓ Yes	□ No
	Open ground/reverse po	olarity: □Yes	□Safety	y Hazard	☑ No	□ Cove	ers missing
Heat source prese	ent: ☑ Yes □ Not vi	sible					
Windows:	☑ Sat. ☐ Marg. ☐ Po	oor Cracked glass	☐ Evid	ence of leaking	ginsulated gl	lass	
Door:	☑ Sat. ☐ Marg. ☐ Po	oor 🗆 Holes 🗆 Doo	es not late	ch 🗆 Hardwa	re broken [□ None	
General Comn	nonte:						
General Comm	ici ilə.						

WINDOWS / FIREPLACES / ATTIC

Interior Windows/Glass					
☐ Hardware missing ☐ Glazing compound needed ☐ Cracked glass ☐ Broken counter-balance mech. ☐ Surface deterioration: (See Remarks page) ☐ Representative number of windows operated Fireplace ☐ None Location(s): Family room ☐ Gas ☐ Wood ☐ Wood burner stove (See Remarks page) ☐ Hearth: Satisfactory: ☐ Yes ☐ No Mantle: ☐ Satisfactory ☐ Loose ☐ Recommend having flue cleaned and re-examined ☐ Vent less ☐ Direct Vent Fireplace ☐ None Location(s): Basement ☐ Gas ☐ Wood ☐ Wood burner stove (See Remarks page) ☐ Masonry insert ☐ Metal insert ☐ Metal ☐ Electric ☐ Open joints or cracks in firebrick should be sealed ☐ Pre-fabricated panels damaged/worn Hearth: Satisfactory: ☐ Yes ☐ No Mantle: ☐ Satisfactory ☐ Loose					
□ Surface deterioration: (See Remarks page) ☑ Representative number of windows operated Fireplace □ None Location(s): Family room □ Gas □ Wood □ Wood burner stove (See Remarks page) □ Masonry insert □ Metal insert □ Metal ☑ Electric Hearth: Satisfactory: □ Yes □ No Mantle: □ Satisfactory □ Loose □ Recommend having flue cleaned and re-examined □ Vent less □ Direct Vent Fireplace □ None Location(s): Basement □ Gas ☑ Wood □ Wood burner stove (See Remarks page) □ Masonry insert □ Metal insert □ Metal ☑ Electric □ Open joints or cracks in firebrick should be sealed □ Pre-fabricated panels damaged/worn Hearth: Satisfactory: ☑ Yes □ No Mantle: ☑ Satisfactory □ Loose					
Fireplace					
Gas					
Gas					
□ Masonry insert □ Metal insert □ Metal ☑ Electric Hearth: Satisfactory: □ Yes □ No Mantle: □ Satisfactory: □ Loose □ Recommend having flue cleaned and re-examined □ Vent less □ Direct Vent Fireplace □ None Location(s): Basement □ Gas ☑ Wood □ Wood burner stove (See Remarks page) □ Masonry insert □ Metal insert □ Metal ☑ Electric □ Open joints or cracks in firebrick should be sealed □ Pre-fabricated panels damaged/worn Hearth: Satisfactory: ☑ Yes □ No Mantle: ☑ Satisfactory □ Loose					
Hearth: Satisfactory: ☐ Yes ☐ No					
□ Recommend having flue cleaned and re-examined □ Vent less □ Direct Vent Fireplace □ None Location(s): Basement □ Gas □ Wood □ Wood burner stove (See Remarks page) □ Masonry insert □ Metal insert □ Metal □ Electric □ Open joints or cracks in firebrick should be sealed □ Pre-fabricated panels damaged/worn Hearth: Satisfactory: □ Yes □ No Mantle: □ Satisfactory □ Loose					
Fireplace □ None Location(s): Basement □ Gas □ Wood □ Wood burner stove (See Remarks page) □ Masonry insert □ Metal insert □ Metal □ Electric □ Open joints or cracks in firebrick should be sealed □ Pre-fabricated panels damaged/worn Hearth: Satisfactory: □ Yes □ No Mantle: □ Satisfactory □ Loose					
Gas ☑ Wood ☐ Wood burner stove (See Remarks page) ☐ Masonry insert ☐ Metal insert ☐ Metal ☑ Electric ☐ Open joints or cracks in firebrick should be sealed ☐ Pre-fabricated panels damaged/worn Hearth: Satisfactory: ☑ Yes ☐ No Mantle: ☑ Satisfactory ☐ Loose					
Gas ☑ Wood ☐ Wood burner stove (See Remarks page) ☐ Masonry insert ☐ Metal insert ☐ Metal ☑ Electric ☐ Open joints or cracks in firebrick should be sealed ☐ Pre-fabricated panels damaged/worn Hearth: Satisfactory: ☑ Yes ☐ No Mantle: ☑ Satisfactory ☐ Loose					
□ Masonry insert □ Metal insert □ Metal □ Electric □ Open joints or cracks in firebrick should be sealed □ Pre-fabricated panels damaged/worn Hearth: Satisfactory: □ Yes □ No Mantle: □ Satisfactory: □ Loose					
☐ Open joints or cracks in firebrick should be sealed Hearth: Satisfactory: ☐ Yes ☐ No Mantle: ☐ Satisfactory ☐ Loose					
Hearth: Satisfactory: ☑ Yes ☐ No Mantle: ☑ Satisfactory ☐ Loose					
□ Recommend having flue cleaned and re-examined □ Vent less □ Direct Vent					
Stairs ✓ Satisfactory ☐ Marginal ☐ Poor ☐ None					
Handrail: ☐ Satisfactory ☐ Marginal ☐ Poor ☐ Safety Hazard					
Risers/Treads: \square Satisfactory \square Marginal \square Poor \square Risers/treads uneven					
Smoke/CO Detectors (See Remarks page)					
Present:					
Note: Working smoke detectors are required on all levels of a home. Working CO detectors are required on all levels of a home with sleeping					
areas. Battery operated detectors should be tested monthly and batteries changed semi annually. Most battery operated units should be replaced					
every 5 yrs and most hardwired units replaced every 10 yrs (see manufactures recommendations).					
Attic					
Access: Access panel Access Location: Bedroom closet Inspected from: Access panel					
Flooring: \square Complete \square Partial \square None					
Insulation: Type: Loose fill fiberglass Average thickness: 9 to 12 inches R Rating: R32 Standard					
Installed in: \square Floor \square Rafters \square Walls \square Not Visible					
Vent fans: ☐ Present ☐ Not tested ☐ Thermostat controlled ☐ Safety Hazard					
Ventilation: Satisfactory					
Roof structure: Wooden rafters					
Roof sheathing: Plywood					
Roof Sheathing Condition: ☑ Satisfactory ☐ Marginal ☐ Poor ☐ Rotted ☐ Stained ☐ Delaminated					
Fans exhausted to: Attic: ☐ Yes ☐ No Outside: ☐ Yes ☐ No ☑ Not visible ☐ N/A (See Remarks page)					
Chimney chase:					
Structural problems observed: \square Yes \square No \square See comments below					
Vapour barriers: ☑ Not visible ☐ Improperly installed					
☐ Kraft faced ☐ Plastic (See Remarks page)					
Electrical: \square Open junction box(es) \square Handyman wiring \square Visible knob-and-tube					
General Comments					

Rafters / Trusses showed no major defects or damage at the time of inspection. Roof sheathing, examined from the attic, showed no major defects or moisture damage. Insulation level is normal for the age of the home. Ventilation was normal.

BASEMENT

(See Remarks page)

(~ * * * - * - * F * * F * 						
Stairs						
Condition:	☑ Satisfactor	ry	☐ Marginal	□ Poor	☐ Safety Haza	rd
Handrail: ☑ Yes	☐ No Coi	ndition:	☑ Satisfactory	☐ Marginal	□ Poor	
Headway over stairs:	☑ Satisfactor	ry	☐ Marginal	□ Poor		
Under carriage:	☑ Satisfactor	ry	☐ Marginal	□ Poor	☐ Not visible	
Foundation						
Wall Material:	Poured Conc	rete				
Condition:	Satisfactory					
Foundation Cracks:	☑ Yes □ N	None Vis	ible Visib	le from: ☑ Exte	erior Interior	
Movement apparent:	□ Yes ☑ N	Vо				
Partially/Covered walls:	☑ Yes □ N	Vо				
	G 114					
	Condition re	eported	above reflects <u>visil</u>	ole portion only		
Floor			(See vapour bar	rier remarks)		
Material:	Concrete		_			
Condition:	Satisfactory					
Seismic Bolts			Not applicable			
Basement Drainage						
Indication of moisture:	No					
Sump Pump:	No Si	ump Pun	np Operates: Not a	pplicable		
Floor drain(s) present:	Yes		1 1	11		
Drain Tile (See Remarks	page)	□Р	almer valve present	☐ Not Visible	e (See Remarks	s page)
`	1 8 /		1		•	1 6 /
Girders (1), Columns (2)			I/A			
	☐ Steel		\square Wood	☐ Block	☐ Concrete	☑ Not visible
Condition:	☐ Satisfactor	ry	☐ Marginal	□ Poor	☐ Stained/ruste	ed
Joists/Trusses						
☑ Joist ☐ Trusses	☐ I-Joist		☐ Steel	☑ Wood	□Concrete	☐ Not visible
	$\square 2x6$		☑ 2x8	□ 2x10	□ 2x12	
Sub Floor						
	☐ Indication	of mois	ture stains/rotting			
			hower stalls, etc., as	s viewed from ba	sement or crawl s	pace
General Comments						
- : : : : : : : : : : : : : : : : : : :						

Foundation appeared to be in overall satisfactory condition. Foundation walls were covered/partially covered with paneling/drywall/insulation and were not visible. No representation can be made to the conditions of the covered/partially covered walls. Floor appeared to be in overall satisfactory condition. No active seepage visible at the time of the inspection. Thermal imaging scans of all the accessible basement exterior walls did not reveal any signs of moisture present. No representation can be made to future leaking of the basement walls.

PLUMBING

Water Service			Shut off location:	Basement		
Water entry piping: Co	pper W	ater	lines: Copper			
	Lead (other th	ian	solder joints):	☐ Yes ☑ No	☐ Service entry	☐ Unknown
	Water flow:		☑ Satisfactory	□ Poor	Cross connection:	\square Yes \square No
	Water pressur	e:	☑ Satisfactory	□ Poor □ Abov	ve 80 psi (Needs eva	luation)
	Pipes: ☐ Co	rroc	led □ Leaking	☐ Valves broken	n/missing	ssimilar metal
Drain/waste/vent pipe:	Plastic					
	Condition:		☑ Satisfactory	☐ Marginal	□ Poor	☐ Not visible
	Waste dischar	ge:	☑ Satisfactory	☐ Slow drain		
Gas Lines			☐ Not visible	☐ Shutoff miss	ing	
	☐ Copper		□ Brass	☑ Black iron	☐ Stainless steel	□ CSST
Well Pump			☑ N/A	(See Remarks	page)	
-	☐ Submersib	le	☐ In basement	☐ Well house	☐ Well pit	☐ Shared well
Pressure gauge operates:	☐ Yes		□ No	☐ Unknown	_	
Sanitary Pump			☑ N/A			
Sealed crock:	□ Yes □	No	Check valve:	□ Yes □No	Vented: □] Yes □No
Water Heater						
Brand name: Giant						
Energy Source: Gas	Approx. ag	ge:5	yrs		Capacity: 60 gallor	n
Rental Unit: Yes			Seismic restraints n	ieeded: ☑ N/A □	Yes □ No	
Relief valve:	☑ Yes □	No	Extension pr	oper:	□ No □ Missi	ng
Vent pipe:	□ N/A ☑ Sa	tisf	actory \square Improper	pitch □ Rusted	☐ Safety Hazard	
Water Equipment			(Units not evalua	ited)		
Water Softener	□Yes ☑	No	Plumbing hoo	oked up:	□No	
Whole Home Filter	□Yes ☑	No	Plumbing hoo	oked up:	□No	
UV Filter	□Yes ☑	No	Plumbing hoo	oked up: ☐ Yes	□No	
General Comments						

Overall the plumbing system, faucets, water pressure and drain rates were found to be in satisfactory condition at the time of the inspections.

HEATING SYSTEM

Fuel Shutoff for	Building	Main fuel s	shutoff location:	Outside at gas m	eter	
	-	•		_		
Forced Air Syste	em	☑ Central	Unit [☐ Wall Furnace	☐ Floor Furnace	
	Brand name: Co	leman		Approximate age: 10 to 15 yrs		
Energy source:	Gas Furna	ce Efficiency:	: High Efficiency	<i></i>		
Hot air systems:	Direct drive	-				
Heat exchanger:	Sealed unit, not visible	View is ex	xtremely limited	l - See Remarks	page about options	
Distribution:	Metal Ducts	Flue pipin	g: Plastic			
Filter: Standard	Filter Condition: Sa	ntisfactory				
Operated:	When turned on l	y thermostat	: ☑ Fired	□ Did :	not fire	
Operation:	Satisfactory:	Yes □ No	☐ Recommend	HVAC technician	n examine ☐ Before closing	
Controls:	□ Disconnect		✓ Normal oper	ating and safety	controls observed	
Heat pump:	☐ Aux. Elec.	☐ Aux. Gas	☐ Aux. geother	rmal 🗹 N/A		
	Emergency heat t	tested:	☐ Yes	□ No	☑ N/A	
HRV System:	✓ Yes	□ No	☐ Operated	☑ Not	operated	
Others		☑ N/A				
	☐ Electric baseb	oard	☐ Radiant ceilin	g cable Gas	space heater	
	☐ Radiant in floor	heating	☐ Wood burnir	ng stove (See Re	emarks page)	
General Comme	ents					

Furnace was in normal working order at the time of the inspection. Filter should be changed /cleaned on regular bases.

Noter: There is some visible apparent mould growth on the drywall inside the furnace room, recommend cleaning with an approved anti-microbial cleaner of replacing the contaminated drywall.

COOLING SYSTEM

System Components		□ None			Approximate a	ge: 1 to 5 yrs
Energy source: Electric	Central air: Air C	Cooled				-
Operated: No	Operation: Not o	perated				
Refrigerant lines:	☐ Leak	☐ Damag	ged	☐ Insulati	on missing	☑ Satisfactory
Through wall unit(s):	☑ N/A	Operated:	☐ Yes	□ No	☐ Satisfactory	☐ Needs service
General Comments						
A/C was not operated d	ue to the outside to	emperature b	eing too col	d		
		El E	CTRIC			
			JINI	JAL		
Main Panel			n: Basemen	t		
	Amps: 100 amps		Volts:120	240 volts	Panel Type: Brea	akers
Appears grounded:	☑ Yes □ No	GFCI	present:	□ Yes 💆	I No Operates:	\square Yes \square No
Main Wire:	Not visible					
Branch Wire:	Copper					
	☑ Romex	☐ BX cal		☐ Conduit		☐ Knob & tube
					_	anel (see Remarks)
	☐ Multiple tappin		connect	☐ Safety H		
	☐ Arc fault prese		Operates:		s \square No \square N/A	(see Remarks)
	☐ Panel not acce	ssible	□ Not eva	aluated Re	ason:	
Electrical Fixtures						
A representative numbe	r of installed light	ing fixtures,	switches, an	d receptacle	es located inside the	house, garage, and
exterior walls were teste	ed and found to be	:				
	☑ Satisfactory			□ Poor		
						ounded 3-prong outlets
	☐ Solid conduct	or aluminur	n branch w	iring circu	its (See Rema	ırks page)
	☐ Recommend a	a licensed ele	ectrician ev	aluate the	service	
General Comments:						
Panel size appeared to h	ne compatible to se	ervice size R	ranch break	er distributi	on appeared normal	No signs of

Panel size appeared to be compatible to service size. Branch breaker distribution appeared normal. No signs of overheating were evident at the time of the inspection. Outlets were randomly tested and had correct polarity, except as noted.

Note: There is some visible wiring inside the furnace room where the Romex wiring is running thru the metal studs without proper protective grommets, recommended review and correction as necessary.

PHOTO GALLERY



Pic. 1: Front view



Pic. 2: Roof covering snow covered



Pic. 3: Roof covering snow



Pic. 4: Back view



Pic. 5: Balcony



Pic. 6: Back yard



Pic. 7: AC compressor 2020



Pic. 8: H+Garage



Pic. 9: Attic



Pic. 10: Attic



Pic. 11: Attic



Pic. 12: Primary bedroom



Pic. 13: Primary bedroom



Pic. 14: Primary bathroom



Pic. 15: Primary bathroom



Pic. 16: Bedroom 2



Pic. 17: Bedroom 3





Pic. 19: 2nd floor bathroom



Pic. 20: 2nd floor bathroom



Pic. 21: Tub drain slow



Pic. 22: Sink drain slow



Pic. 23: Living room



Pic. 24: Dining room



Pic. 25: Family room



Pic. 26: Eating area



Pic. 27: Kitchen



Pic. 28: Kitchen



Pic. 29: Kitchen



Pic. 30: Rec room



Pic. 31: Basement room



Pic. 32: Basement bathroom





Pic. 34: Visible apparent mould growth in furnace room



Pic. 35: Outlet box wired incorrectly



Pic. 36: Romex run thru metal stubs without a grommet



Pic. 37: Romex run thru metal stubs without a grommet



Pic. 38: Visible apparent mould



Pic. 39: Water main



Pic. 40: Water heater 2020



Pic. 41: Gas furnace 2012



Pic. 42: 100 amp breaker panel



Pic. 43: Apt – Living room



Pic. 44: Apt – Kitchen



Pic. 45: Apt – Bedroom





Pic. 46: Apt – bathroom

Pic. 47: HRV system

GENERAL REMARKS

List below are general remarks about the different areas and components of a home. These remarks are for general information purposes only and some of the information provided may not be specific to the home inspected.

GROUNDS REMARKS

Service Walks/Driveways

Spalling concrete cannot be patched with concrete because the new will not bond with the old. Water will freeze between the two layers, or the concrete will break up from movement or wear. Replacement of the damaged section is recommended. Walks or driveways that are close to the property should be properly pitched away to direct water away from the foundation. Asphalt driveways should be kept sealed and larger cracks filled so as to prevent damage from frost.

Patios that have settled towards the structure should be mudjacked or replaced to assure proper pitch. Improperly pitched patios are one source of wet basements.

Exterior Wood Surfaces

All surfaces of untreated wood need regular applications of paint or special chemicals to resist damage. Porch or deck columns and fence posts which are buried in the ground and made of untreated wood will become damaged within a year or two.

Decks should always be nailed with galvanized or aluminium nails. Decks that are not painted or stained should be treated with a water sealer.

Grading and Drainage

Any system of grading or landscaping that creates positive drainage (moving water away from the foundation walls) will help to keep a basement dry. Where negative grade exists and additional backfill is suggested, it may require digging out around the property to get a proper pitch. Dirt shall be approximately 15 cm below the bottom sill and should not touch wood surfaces.

Flower beds, loose mulched areas, railroad ties and other such landscaping items close to the foundation trap moisture and contribute to wet basements. To establish a positive grade, a proper slope away from the house is 2.5 cm per meter for approximately 1.5 to 2 meters. Recommend ground cover planting or grass to foundation.

Roof and Surface Water Control

Roof and surface water must be controlled to maintain a dry basement. This means keeping gutters cleaned out and aligned, extending downspouts, installing splash blocks, and building up the grade so that roof and surface water is diverted away from the building.

Window Wells

The amount of water which enters a window well from falling rain is generally slight, but water will accumulate in window wells if the yard is improperly graded. Plastic window well covers are useful in keeping out leaves and debris.

Retaining Walls

Retaining walls deteriorate because of excessive pressure build-up behind them, generally due to water accumulation. Often, conditions can be improved by excavating a trench behind the retaining wall and filling it with coarse gravel. Drain holes through the wall will then be able to relieve the water pressure.

Retaining walls sometime suffer from tree root pressure or from general movement of topsoil down the slope. Normally, these conditions require rebuilding the retaining wall.

Railings

It is recommended that railings be installed for any stairway over 3 steps and porches over 75 cm for safety reasons. Balusters for porches, balconies, and stairs should be close enough to assure children cannot squeeze through.

ROOF COVERING REMARKS

Valleys & Flashings

Valleys and flashings that are covered with shingles and/or tar or any other material are considered not visible and are not part of the inspection.

Stone Roofs - Coverings

This type of covering on a pitched roof requires ongoing annual maintenance. We recommend that a roofing contractor evaluate this type of roof. Infra-red photography is best used to determine areas of potential leaks.

Flat Roofs

Flat roofs are very vulnerable to leaking. It is very important to maintain proper drainage to prevent ponding of water. We recommend that a roofing contractor evaluate this type of roof.

ROOF TYPE	LIFE EXPECTANCY	SPECIAL REMARKS
Asphalt Shingles	15-20 years	Used on nearly 80% of all residential roofs; requires little maintenance
Asphalt Multi-Thickness Shingles*	20-30 years	Heavier and more durable than regular asphalt shingles
Asphalt Interlocking Shingles*	15-25 years	Especially good in high-wind areas
Asphalt Rolls	10 years	Used on low slope roofs
Built-up Roofing	10-20 years	Used on low slope roofs; 2 to 3 times as costly as asphalt shingles
Wood Shingles*	10-40 years ¹	Treat with preservative every 5 years to prevent decay
Clay Tiles* Cement Tiles*	20 + years 20 + years	Durable, fireproof, but not watertight, requiring a good subsurface base
Slate Shingles*	30-100 years ²	Extremely durable, but brittle and expensive
Asbestos Cement Shingles*	30-75 years	Durable, but brittle and difficult to repair
Metal Roofing	15-40 + years	Comes in sheets & shingles; should be well grounded for protection from lightning; certain metals must be painted
Single Ply Membrane	15-25 years (mfgr's claim)	New material; not yet passed test of time

Roof covering should be visually checked in spring and fall for any visible missing shingles, damaged coverings or other defects. Before re-roofing, the underside of the roof structure and roof sheathing should be inspected to determine that the roof structure can support the additional weight of the shingles.

Wood shakes and shingles will vary in aging, due to quality of the material, installation, maintenance, and surrounding shade trees. Ventilation and drying of the wood material is critical in extending the life expectancy of the wood. Commercial preservatives are available on the market, which could be applied to wood to impede deterioration.

^{*} Not recommended for use on low slope roof 1 Depending on local conditions and proper installation

² Depending on quality of slate

CHIMNEY / GUTTERS / SIDING / TRIM REMARKS

Chimneys

Chimneys built of masonry will eventually need tuck pointing. A cracked chimney top that allows water and carbonic acid to get behind the surface brick/stone will accelerate the deterioration. Moisture will also deteriorate the clay flue liner. Periodic chimney cleaning will keep you apprised of the chimney's condition. The flashing around the chimney may need resealing and should be inspected every year or two. Fireplace chimneys should be inspected and evaluated by a chimney professional before using. Chimneys must be adequate height for proper drafting. Spark arrestors are recommended for wood burning chimney and chimney caps for fossil fuels

Unlined Chimney - should be re-evaluated by a chimney technician.

Have flue cleaned and re-evaluated. The flue lining is covered with soot or creosote and no representation can be made as to the condition.

NOT EVALUATED- The flue was not evaluated due to inaccessibility such as roof pitch, cap, cleanout not accessible, etc.

Cricket Flashing

Small, sloped structure made of metal and designed to drain moisture away from a chimney. Crickets are usually placed at the back of a chimney.

Gutters and Downspouts

This is an extremely important element in basement dampness control. Keep gutters clean and downspout extensions in place (1.25 meters or more). Paint the inside of galvanized gutters, which will extend the life. Shortly after a rain or thaw in winter, look for leaks at seams in the gutters. These can be re-caulked before they cause damage to fascia or soffit boards. If no gutters exist, it is recommended that they be added.

Siding

Wood siding should not come in contact with the ground. The moisture will cause rotting to take place and can attract carpenter ants.

EIFS - This type of siding has experienced serious problems and requires a certified EIFS inspector to determine condition.

Brick and stone veneer must be monitored for loose or missing mortar. Some brick and stone are susceptible to spalling. This can be caused when moisture is trapped and a freeze/thaw situation occurs. There are products on the market that can be used to seal out the moisture. This holds true for brick and stone chimneys also.

Metal sidings will dent and scratch. Oxidation is a normal reaction in aluminum. There are good cleaners on the market and it is recommended that they be used occasionally. Metal siding can be painted.

Doors and Windows

These can waste an enormous amount of energy. Maintain the caulking around the frames on the exterior. Check for drafts in the winter and improve the worst offenders first. Windows that have leaky storm windows will usually have a lot of sweating. Likewise, well-sealed storms that sweat indicate a leaky window. It is the tighter unit that will sweat (unless the home has excess humidity to begin with.)

Wood that exhibits blistering or peeling paint should be examined for possible moisture sources: roof leaks, bad gutters, interior moisture from baths or laundry or from a poorly vented crawl space. Some paint problems have no logical explanation, but many are a symptom of an underlying problem. A freshly painted house may mask these symptoms, but after you have lived in the home for a year or two, look for localized paint blistering (peeling). It may be a clue.

New glazing will last longer if the raw wood is treated with boiled linseed oil prior to glazing. It prevents the wood from drawing the moisture out of the new glazing.

Caulking

Many different types of caulk are available on the market today. Check with a paint or hardware store for the kind of application you need.

EXTERIOR / ELECTRICAL / AC / GARAGE REMARKS

Exterior Doors

The exposed side of wood exterior doors needs to be painted or stained and varnished to prevent discolouring and delamination. Weather-stripping is a must to prevent drafts.

Electrical

Overhead wires from the mast to the main panel that are exposed to the weather may fray and crack. If this occurs, wires should be replaced by a licensed electrician.

Any outdoor overhead service conductor wires should have adequate clearance above the ground (3 meters) and from balcony and windows (1 meter), for safety reasons.

Underground system - Some exterior boxes that are at ground level have a grade line on them. You should insure that the grade remains below this line to prevent moisture from entering the main panel.

Overhead Door Openers

We recommend that a separate electrical outlet be provided. Openers that do not have a safety reverse are considered a safety hazard. Small children and pets are especially vulnerable. We recommend the operating switches be set high enough so children cannot reach them. If an electric sensor is present, it should be tested occasionally to ensure it is working.

Garage Sill Plates

Sill plates within the garage should be elevated or treated lumber should be used. If this is not the case, try to direct water away to prevent rotting.

A/C Compressors

They should not become overgrown with foliage. Clearance requirements vary, but 60 cm on all sides should be considered minimal with up to 2 meters of air discharge desirable. If a clothes dryer vent is within five to ten feet, either relocate the vent or do not run when the A/C is running. The lint will quickly reduce the efficiency of the A/C unit.

Burners

Any appliance such as a water heater, furnace, etc. should have the flame a minimum of 45 cm above the floor. Any open flame less than 45 cm from the floor is a potential safety hazard. The appliance should also be protected from vehicle damage.

KITCHEN / LAUNDRY / UTILITY ROOM REMARKS

Plaster on Wood Lath

Plaster on wood lath is an old technique and is no longer in general use. Wood lath shrinks with time and the nails rust and loosen. As a result, the plaster may become fragile and caution is needed in working with this type of plastering system. Sagging ceilings are best repaired by laminating drywall over the existing plaster and screwing it to the ceiling joists.

Plaster on Gypsum Lath (Rock Lath)

Plaster on gypsum lath will sometimes show the seams of the 40 cm wide gypsum lath, but this does not indicate a structural fault. The scalloping appearance can be levelled with drywall joint compound and fibreglass mesh joint tape or drywall can be laminated over the existing plaster on the ceiling.

Wood Flooring

Always attempt to clean wood floors first before making the decision to refinish the floor. Wax removers and other mild stripping agents plus a good waxing and buffing will usually produce satisfactory results. Mild bleaching agents help remove deep stains. Sanding removes some of the wood in the floor and can usually be done safely only once or twice in the life of the floor.

Nail Pops

Drywall nail pops are due to normal expansion and contraction of the wood members to which the drywall is nailed, and are usually of no structural significance.

Carpeting

Where carpeting has been installed, the materials and condition of the floor underneath cannot be determined.

Appliances

Dishwashers are tested to see if the motor operates and water sprays properly (full cycles are not run). Stoves are tested to see that burners are working and oven and broiler get hot. Timer and controls are not tested. Refrigerators are not tested.

No representation is made to continued life expectancy of any appliance.

Asbestos and Other Hazards

Asbestos fibres in some form are present in many homes, but are often not visible and cannot be identified without testing.

If there is reason to suspect that asbestos may be present and if it is of particular concern, a sample of the material in question may be removed and analyzed in a laboratory. *However, detecting or inspecting for the presence or absence of asbestos is not a part of our inspection.*

Also excluded from this inspection and report are the possible presence of, or danger from, radon gas, lead-based paint, urea formaldehyde, toxic or flammable chemicals and all other similar or potentially harmful substances and environmental hazards.

Windows

A representative number of windows are inspected.

BATHROOM REMARKS

Stall Shower

The metal shower pan in a stall shower has a potential or probable life of 10-20 years depending on quality of the pan installed. Although a visible inspection is made to determine whether a shower pan is currently leaking, it cannot be stated with certainty that no defect is present or that one may not soon develop. Shower pan leaks often do not show except when the shower is in actual use.

Ceramic Tile

Bathroom tile installed in a mortar bed is excellent. It is still necessary to keep the joint between the tile and the tub/shower caulked or sealed to prevent water spillage from leaking through and damaging the ceilings below.

Ceramic tile is often installed in mastic. It is important to keep the tile caulked or water will seep behind the tile and cause deterioration in the wallboard. Special attention should be paid to the area around faucets and other tile penetrations.

Exhaust Fans

Bathrooms with a shower should have exhaust fans where possible. This helps to remove excess moisture from the room, preventing damage to the ceiling and walls and wood finishes. The exhaust fan should not be vented into the attic. The proper way to vent the fans is to the outside. Running the vent pipe horizontally and venting into a gable end or soffit is preferred. Running the vent pipe vertically through the roof may cause condensation to run down the vent pipe, rusting the fan and damaging the wallboard. Insulating the vent pipe in the attic will help to reduce this problem.

SLOW DRAINS on sinks, tubs, and showers are usually due to build-up of hair and soap scum. Most sink pop-ups can be easily removed for cleaning. Some tubs have a spring attached to the closing lever that acts as a catch for hair. It may require removing a couple of screws to disassemble. If you cannot mechanically remove the obstruction, be kind to your pipes. Don't use a caustic cleaner. There are several bacteria drain cleaners available. They are available at hardware stores in areas where septic tanks are used. These drain cleaners take a little longer to work, but are safe for you and your pipes.

Safety Hazards

Typical safety hazards found in bathrooms are open grounds or reverse polarity by water. Replacing these outlets with G.F.C.I.'s are recommended. (See Electrical section)

Whirlpool Tubs

This relates to interior tubs hooked up to interior plumbing. Where possible, the motor will be operated to see that the jets are working. Hot tubs and spas are not inspected.

ROOMS (INTERIOR) REMARKS

Door Stops

All swinging doors should be checked for door stops. Broken or missing door stops can result in door knobs breaking through drywall or plaster.

Closet Guides

Sliding closet doors should be checked to see that closet guides are in place. Missing or broken closet guides can cause scratches and damage to doors.

Cold Air Returns

Bedrooms that do not have cold air returns in them should have a 1.75 cm gap under the doors to allow cold air to be drawn into the hall return.

AN INSPECTION VERSUS A WARRANTY

A home inspection is just what the name indicates, an inspection of a home...usually a home that is being purchased. The purpose of the inspection is to determine the condition of the various systems and structures of the home. While an inspection performed by a competent inspection firm will determine the condition of the major components of the home, no inspection will pick up every minute latent defect. The inspector's ability to find all defects is limited by access to various parts of the property, lack of information about the property and many other factors. A good inspector will do his or her level best to determine the condition of the home and to report it accurately. The report that is issued is an opinion as to the condition of the home. This opinion is arrived at by the best technical methods available to the home inspection industry. It is still only an opinion.

A warranty is a policy sold to the buyer that warrants that specific items in the home are in sound condition and will remain in sound condition for a specified period of time. Typically, the warranty company never inspects the home. The warranty company uses actuarial tables to determine the expected life of the warranted items and charges the customer a fee for the warranty that will hopefully cover any projected loss and make a profit for the warranty seller. It is essentially an insurance policy.

The service that we have provided you is an inspection. We make no warranty of this property. If you desire warranty coverage, please see your real estate agent for details about any warranty plan to which their firm may have access.

WINDOWS / FIREPLACES / ATTIC REMRKS

Window Frames and Sills

Window frames and sills often are found to have surface deterioration due to condensation that has run off the window and damaged the varnish. Usually this can be repaired with a solvent style refinisher and fine steel wool. This is sometimes a sign of excess humidity in the house.

See comments regarding caulking doors and windows above (Chimneys/Gutters/Siding).

Fireplaces

It is important that a fireplace be cleaned on a routine basis to prevent the build-up of creosote in the flue, which can cause a chimney fire.

Masonry fireplace chimneys are normally required to have a terra cotta flue liner or 8 inches of masonry surrounding each flue in order to be considered safe and to conform to most building codes.

During visual inspections, it is not uncommon to be unable to detect the absence of a flue liner either because of stoppage at the firebox, a defective damper or lack of access from the roof.

Wood burners

Once installed, it can be difficult to determine proper clearances for wood burning stoves. Manufacturer specifications, which are not usually available to the inspector, determine the proper installation. We recommend you ask the owner for paperwork verifying that it was installed by a professional contractor.

Ventilation

Ventilation is recommended at the rate of one square foot of vent area to 300 square feet of attic floor space, this being divided between soffit and rooftop. Power vents should ideally have both a humidistat and a thermostat, since ventilation is needed to remove winter moisture as well as summer heat. Evidence of condensation, such as blackened roof sheathing, frost on nail heads, etc. is an indication that ventilation may have been or is blocked or inadequate.

Insulation

The recommended insulation in the attic area is R-38, approximately 30cm. If insulation is added, it is important that the ventilation is proper.

Smoke Detectors

Smoke detectors should be tested monthly. At least one detector should be on each level.

Vapour Barriers

The vapour barrier should be on the warm side of the surface. Older homes were often built without vapour barriers. If the vapour barrier is towards the cold side of the surface, it should be sliced or removed. Most vapour barriers in the attic are covered by insulation and therefore, not visible.

Safety Glazing

Safety glazing requirements vary depending on the age of the home. Every attempt is made to identify areas where the lack of safety glazing presents an immediate safety hazard, such as a shower door. In some older homes it is difficult to determine if safety glazing is present, since the glass is not marked. Therefore, no representation is made that safety glazing exists in all appropriate areas.

Insulated Glass

The broken seals are not always detectable due to dirty windows, covered windows, etc. In most cases, leaking glass seals take some time before they are evident.

BASEMENT REMARKS

Basement

Any basement that has cracks or leaks is technically considered to have failed. Most block basements have step cracks in various areas. If little or no movement has occurred, and the step cracks are uniform, this is considered acceptable. Horizontal cracks in the third or fourth block down indicate the block has moved due to outside pressure. They can be attributed to many factors, such as improper grading, improperly functioning gutter and downspout system, etc. Normally, if little or no movement has taken place and proper grading and downspouts exist, this is considered acceptable. If the wall containing the stress crack(s) has moved considerably, this will require some method of reinforcement. Basements that have been freshly painted or tuck-pointed should be monitored for movement. This will be indicated by cracks reopening. If cracks reappear, reinforcement may be necessary. Reinforcing a basement wall can become expensive.

Foundation (Covered Walls)

Although an effort has been made to note any major inflections or weaknesses, it is difficult at best to detect these areas when walls are finished off, or basement storage makes areas inaccessible. *No representation is made as to the condition of these walls.*

Monitor indicates that the walls have stress cracks, but little movement has occurred. In our opinion, the cracks should be filled with mortar and the walls monitored for further movement and cracking. If additional movement or cracking occurs, re-enforcements may be necessary.

Have Evaluated — we recommend that the walls be re-evaluated by a structural engineer or basement repair company and estimates be obtained if work is required.

Vapour Barrier

Floors that are dirt or gravel should be covered with a vapour barrier.

Moisture Present

Basement dampness is frequently noted in houses and in most cases the stains, moisture or efflorescence present is a symptom denoting that a problem exists outside the home. Usual causes are improper downspout extensions or leaking gutters and/or low or improper grade (including concrete surfaces) at the perimeter of the house. A proper slope away from the house is one inch per foot for four to six feet.

Expensive solutions to basement dampness are frequently offered, and it is possible to spend thousands of dollars on solutions such as pumping out water that has already entered or pumping of chemical preparations into the ground around the house, when all that may be necessary are a few common sense solutions at the exterior perimeter. However, this is not intended to be an exhaustive list of causes and solutions to the presence of moisture. *No representation is made to future moisture that may appear.*

Palmer Valve

Many older homes have a valve in the floor drain. This drain needs to remain operational.

Drain Tile

We offer no opinion about the existence or condition of the drain tile, as it cannot be visibly inspected.

Basement Electrical Outlets

We recommend that you have an outlet within 2 meters of each appliance. The appliance you plan to install may be different than what exists; therefore the inspection includes testing a representative number of receptacles that exist. It is also recommended to have ground fault circuit interrupts for any outlet in the unfinished part of the basement and crawl spaces.

PLUMBING REMARKS

Wells

Examination of wells is not included in this visual inspection. It is recommended that you have well water checked for purity by the local health authorities and, if possible, a check on the flow of the well in periods of drought. A well pit should have a locked cover on it to prevent anyone from falling into the pit.

Septic Systems

The check of septic systems is not included in our visual inspection. You should have the local health authorities or other qualified experts check the condition of a septic system.

In order for the septic system to be checked, the house must have been occupied within the last 30 days.

Water Pipes

Galvanized water pipes rust from the inside out and may have to be replaced within 20 to 30 years. This is usually done in two stages: horizontal piping in the basement first and vertical pipes throughout the house later as needed.

Copper pipes usually have more life expectancy and may last as long as 60 years before needing to be replaced.

Polybutylene pipes are grey pipes that have a history of failure and should be examined by a licensed plumber.

Hose Bibs

During the winter months it is necessary to make sure the outside faucets are winterized. This can be done by means of a valve located in the basement. Leave the outside faucets open to allow any water standing in the pipes to drain, preventing them from freezing. Hose bibs cannot be tested when winterized.

Water Heater

The life expectancy of a water heater is 5-10 years. Water heaters generally need not be replaced unless they leak. It is a good maintenance practice to drain 5-10 gallons from the heater several times a year. *Missing relief valves or improper extension present a safety hazard.*

Water Softeners

During a visual inspection, it is not possible to determine if water is being properly softened.

Plumbing

The temperature/pressure valve should be tested several times a year by lifting the valve's handle. Caution: very hot water will be discharged. If no water comes out, the valve is defective and must be replaced.

Shut-Off Valves

Most shut-off valves have not been operated for long periods of time. We recommend operating each shut-off valve to: toilet bowl, water heater, under sinks, main shut-off, hose faucets, and all others. We recommend you have a plumber do this, as some of the valves may need to be repacked or replaced. Once the valves are in proper operating order, we recommend opening and closing these valves several times a year.

Polybutylene Piping

This type of piping has a history of problems and should be examined by a licensed plumber and repaired or replaced as necessary.

MECHANICAL DEVICES MAY OPERATE AT ONE MOMENT AND LATER MALFUNCTION;
THEREFORE, LIABILITY IS SPECIFICALLY LIMITED TO THOSE SITUATIONS WHERE IT CAN BE
CONCLUSIVELY SHOWN THAT THE MECHANICAL DEVICE INSPECTED WAS INOPERABLE OR IN
THE IMMEDIATE NEED OF REPAIR OR NOT PERFORMING THE FUNCTION FOR WHICH IS IT WAS
INTENDED AT THE TIME OF INSPECTION.

HEATING SYSTEM REMARKS

HEATING AND AIR CONDITIONING units have limited lives. Normal lives are:

GAS-FIRED HOT AIR	15-25 years
OIL-FIRED HOT AIR	.20-30 years
CAST IRON BOILER	. 30-50 years
(Hot water or steam)	or more
STEEL BOILER	. 30-40 years
(Hot water or steam)	or more
COPPER BOILER	. 10-20 years
(Hot water or steam)	
CIRCULATING PUMP (Hot water)	. 10-15 years
AIR CONDITIONING COMPRESSOR	8-12 years
HEAT PUMP	8-12 years

Gas-fired hot air units that are close to or beyond their normal lives have the potential of becoming a source of carbon monoxide in the home. You may want to have such a unit checked every year or so to assure yourself that it is still intact. Of course, a unit of such an age is a good candidate for replacement with one of the new, high efficiency furnaces. The fuel savings alone can be very attractive.

Boilers and their systems may require annual attention. If you are not familiar with your system, have a heating contractor come out in the fall to show you how to do the necessary things. *Caution: do not add water to a hot boiler!*

Forced air systems should have filters changed every 30 to 60 days of the heating and cooling season. This is especially true if you have central air conditioning. A dirty air system can lead to premature failure of your compressor - a \$1,500 machine.

Oil-fired furnaces and boilers should be serviced by a professional each year. Most experts agree you will pay for the service cost in fuel saved by having a properly tuned burner.

Read the instructions for maintaining the humidifier on your furnace. A malfunctioning humidifier can rust out a furnace rather quickly. It is recommended that the humidifier be serviced at the same time as the furnace, and be cleaned regularly. *During a visual inspection it is not possible to determine if the humidifier is working.*

Have HVAC Technician Examine - A condition was found that suggests a heating contractor should do a further analysis. We suggest doing this before closing.

Heat exchangers cannot be examined nor their condition determined without being disassembled. Since this is not possible during a visual, non-technically exhaustive inspection, you may want to obtain a service contract on the unit or contact a furnace technician regarding a more thorough examination.

Testing pilot safety switch requires blowing out the pilot light. Checking safety limit controls requires disconnecting blower motor or using other means beyond the scope of this inspection. If furnace has not been serviced in last 12 months, you may want to have a furnace technician examine.

CO Test - This is not part of a non-technical inspection.

Combustible Gas Test (Potential Safety Hazard) - If a combustible gas detector was used during the inspection of the furnace and evidence of possible combustible gases was noted, we caution you that our test instrument is sensitive to many gases and not a foolproof test. None-the-less, this presents the <u>possibility</u> that a hazard exists and could indicate that the heat exchanger is, or will soon be, defective.

COOLING SYSTEM / ELECTRICAL REMARKS

Electrical

Every effort has been made to evaluate the size of the service. Three wires going into the home indicate 240 volts. The total amps are sometimes difficult to determine. We highly recommend that ground fault circuit interrupters (G.F.C.I.) be connected to all outlets around water. This device automatically opens the circuit when it senses a current leak to ground. This device can be purchased in most hardware stores. G.F.C.I.'s are recommended by all outlets located near water, outside outlets, or garage outlets. Pool outlets should also be protected with a G.F.C.I.

The G.F.C.I. senses the flow of electricity through a circuit. If more current is flowing through the black ("hot") wire than the white ("neutral") wire, there is a current leakage. The G.F.C.I., which can sense a ground leak of as little as .005 amps, will shut off the current in 1/40 of a second, which is fast enough to prevent injury.

If you do have G.F.C.I.'s, it is recommended that you test (and reset) them monthly. When you push the test button, the reset button should pop out, shutting off the circuit. If it doesn't, the breaker is not working properly. If you don't test them once a month, the breakers have a tendency to stick, and may not protect you when needed.

Knob and tube wiring found in older homes should be checked by an electrician to insure that the wire cover is in good condition. Under no circumstances should this wire be covered with insulation. Recess light fixtures should have a baffle around them so that they are not covered with insulation. The newer recessed fixtures will shut off if they overheat.

Federal Pacific electrical panels may be unsafe. See www.google.com and search for "Federal Pacific" for additional and up-to-date information.

Aluminum wiring in general lighting circuits has a history of overheating, with the potential of a fire. If this type of wiring exists, a licensed electrical contractor should examine the whole system.

Arc Faults

In some areas, arc faults are required in new homes, starting in 2002. These control outlets in the bedrooms.

Reverse Polarity

A common problem that surfaces in many homes is reverse polarity. This is a potentially hazardous situation in which the hot and neutral wires of a circuit are reversed at the outlet, thereby allowing the appliance to incorrectly be connected. This is an inexpensive item to correct.

Each receptacle has a brass and silver screw. The black wire should be wired to the brass screw and the white wire should go to the silver screw. When these wires are switched, this is called "reverse polarity". Turning off the power and switching these wires will correct the problem.

Main service wiring for housing is typically 240 volts. The minimum capacity for newer homes is 100 amps, though many older homes still have 60 amp service. Larger homes or all electric homes will likely have a 200 amp service.

Main service wiring may be protected by one or more circuit breakers or fuses. While most areas allow up to six main turnoffs, expanding from these panels is generally not allowed.

Cooling

Testing A/C System and Heat Pump - The circuit breakers to A/C should be on for a minimum of 24 hours and the outside temperature at least 15 °C for the past 24 hours or an A/C system cannot be operated without possible damage to the compressor. Check the instructions in your A/C manual or on the outside compressor before starting up in the summer. Heat pump can only be tested in the mode it's running in. Outside temperature should be at least 15 °C for the past 24 hours to run in cooling mode.

Temperature differential, between 7°-15°, is usually acceptable. If out of this range, have an HVAC contractor examine it. It is not always feasible to do a differential test due to high humidity, low outside temperature, etc.

HOME MAINTENANCE SCHEDULE

Regular Maintenance Is the Key

Inspecting your home on a regular basis and following good maintenance practices is the best way to protect your investment in your home. Whether you take care of a few tasks at a time or several all at once, it is important to get into the habit of doing them. Establish a routine for yourself and you will find the work is easy to accomplish and not very time consuming. A regular schedule of seasonal maintenance can put a stop to the most common — and costly — problems, before they occur. If necessary use a camera to take pictures of anything you might want to share with an expert for advice or to monitor or remind you of a situation later.

By following the information noted here, you will learn about protecting your investment and how to help keep your home a safe and healthy place to live.

If you do not feel comfortable performing some of the home maintenance tasks listed below, or have the necessary equipment, for example a ladder, you may want to consider hiring a qualified handy person to help you.

Seasonal Home Maintenance

Most home maintenance activities are seasonal. Fall is the time to get your home ready for the coming winter, which can be the most grueling season for your home. During winter months, it is important to follow routine maintenance procedures, by checking your home carefully for any problems arising and taking corrective action as soon as possible. Spring is the time to assess winter damage, start repairs and prepare for warmer months. Over the summer, there are a number of indoor and outdoor maintenance tasks to look after, such as repairing walkways and steps, painting and checking your chimney and roof.

While most maintenance is seasonal, there are some things you should do on a frequent basis year round:
Make sure air vents indoors and outside (intake, exhaust and forced air) are not blocked by snow or debris.
Check and clean range hood filters on a monthly basis.
Test the ground fault circuit interrupter(s) monthly by pushing the test button, which should then cause the reset button to pop up.
If there are young children in the house, make sure electrical outlets are equipped with safety plugs.
Regularly check the house for safety hazards such as a loose handrail, lifting or buckling carpet, etc.

Timing of the seasons varies not only from one area of Canada to another, but also from year to year in a given area. For this reason, we have not identified the months for each season. The maintenance schedule presented here, instead, is a general guide for you to follow. The actual timing is left for you to decide, and you may want to further divide the list of items for each season into months.

Fall

Have furnace or heating system serviced by a qualified service company every two years for a gas furnace, and every year for an oil furnace.
Open furnace humidifier damper on units with central air conditioning and clean humidifier.
Lubricate circulating pump on hot water heating system.
Bleed air from hot water radiators.
Examine the forced air furnace fan belt for wear, looseness or noise; clean fan blades of any dirt buildup (after disconnecting the electricity to the motor first).
Turn ON gas furnace pilot light.
Check and clean or replace furnace air filters each month during the heating season. Ventilation system, such as heat recovery ventilator, filters should be checked every two months.
Vacuum electric baseboard heaters to remove dust.
Remove the grilles on forced air systems and vacuum inside the ducts.
If the heat recovery ventilator has been shut off for the summer, clean the filters and the core, and pour water down the condensate drain to test it.
Clean portable humidifier, if one is used.
Have well water tested for quality. It is recommended that you test for bacteria every six months.
Check sump pump and line to ensure proper operation, and to ascertain that there are no line obstructions or visible leaks.
Replace window screens with storm windows.
Remove screens from the inside of casement windows to allow air from the heating system to keep condensation off window glass.
Ensure all doors to the outside shut tightly, and check other doors for ease of use. Renew door weatherstripping if required.
If there is a door between your house and the garage, check the adjustment of the self-closing device to ensure it closes the door completely.
Ensure windows and skylights close tightly.
Cover outside of air conditioning units.
Ensure that the ground around your home slopes away from the foundation wall, so that water does not drain into your basement.
Clean leaves from eaves troughs and roofs, and test downspouts to ensure proper drainage from the roof.
Check chimneys for obstructions such as nests.
Drain and store outdoor hoses. Close valve to outdoor hose connection and drain the hose bib (exterior faucet), unless your house has frost proof hose bibs.
If you have a septic tank, measure the sludge and scum to determine if the tank needs to be emptied before the spring. Tanks should be pumped out at least once every three years.
Winterize landscaping, for example, store outdoor furniture, prepare gardens and, if necessary, protect young trees or bushes for winter.

Winter

Check and clean or replace furnace air filters each month during the heating season. Ventilation system, such as heat recovery ventilator, filters should be checked every two months.
After consulting your hot water tank owner's manual, drain off a dishpan full of water from the clean-out valve at the bottom of your hot water tank to control sediment and maintain efficiency.
Clean humidifier two or three times during the winter season.
Vacuum bathroom fan grille.
Vacuum fire and smoke detectors, as dust or spider webs can prevent them from functioning.
Vacuum radiator grilles on back of refrigerators and freezers, and empty and clean drip trays.
Check gauge on all fire extinguishers; recharge or replace if necessary.
Check fire escape routes, door and window locks and hardware, and lighting around outside of house; ensure family has good security habits.
Check the basement floor drain to ensure the trap contains water. Refill with water if necessary.
Monitor your home for excessive moisture levels—for example, condensation on your windows, which can cause significant damage over time and pose serious health problems—and take corrective action.
Check all faucets for signs of dripping and change washers as needed. Faucets requiring frequent replacement of washers may be in need of repair.
If you have a plumbing fixture that is not used frequently, such as a laundry tub or spare bathroom sink, tub or shower stall, run some water briefly to keep water in the trap.
Clean drains in dishwasher, sinks, bathtubs and shower stalls.
Test plumbing shut-off valves to ensure they are working and to prevent them from seizing.
Examine windows and doors for ice accumulation or cold air leaks. If found, make a note to repair or replace in the spring.
Examine attic for frost accumulation. Check roof for ice dams or icicles. If there is excessive frost or staining of the underside of the roof, or ice dams on the roof surface.
Check electrical cords, plugs and outlets for all indoor and outdoor seasonal lights to ensure fire safety: if worn, or plugs or cords feel warm to the touch, replace immediately.

Spring

After consulting your hot water tank owner's manual, carefully test the temperature and pressure relief valve to ensure it is not stuck. (Caution: This test may release hot water that can cause burns.)
Check and clean or replace furnace air filters each month during the heating season. Ventilation system, for example heat recovery ventilator, filters should be checked every two months.
Have fireplace or woodstove and chimney cleaned and serviced as needed.
Shut down and clean furnace humidifier, and close the furnace humidifier damper on units with central air conditioning.
Check air conditioning system and have serviced every two or three years.
Clean or replace air conditioning filter (if applicable).
Check dehumidifier and clean if necessary.
Turn OFF gas furnace and fireplace pilot lights where possible.
Have well water tested for quality. It is recommended that you test for bacteria every six months.
Check smoke, carbon monoxide and security alarms and replace batteries.
Clean windows, screens and hardware, and replace storm windows with screens. Check screens first and repair or replace if needed.
Open valve to outside hose connection after all danger of frost has passed.
Examine the foundation walls for cracks, leaks or signs of moisture, and repair as required. Repair and paint fences as necessary.
Ensure sump pump is operating properly before the spring thaw sets in. Ensure discharge pipe is connected and allows water to drain away from the foundation.
Re-level any exterior steps or decks which moved due to frost or settling.
Check eaves troughs and downspouts for loose joints and secure attachment to your home, clear any obstructions, and ensure water flows away from your foundation.
Clear all drainage ditches and culverts of debris.
Undertake spring landscape maintenance and, if necessary, fertilize young trees.

Summer

Monitor basement humidity and avoid relative humidity levels above 60 per cent. Use a dehumidifier to maintain safe relative humidity. Clean or replace air conditioning filter, and wash or replace ventilation system filters if necessary.
Check basement pipes for condensation or dripping, and take corrective action, for example, reduce humidity and or insulate cold water pipes.
Check the basement floor drain to ensure the trap contains water. Refill with water if necessary.
If you have a plumbing fixture that is not used frequently, for example, a laundry tub or spare bathroom sink, tub or shower stall, run some water briefly to keep water in the trap.
Deep clean carpets and rugs.
Vacuum bathroom fan grille.
Disconnect the duct connected to the dryer and vacuum lint from duct, the areas surrounding your clothes dryer and your dryer's vent hood outside.
Check security of all guardrails and handrails.
Check smooth functioning of all windows and lubricate as required.
Inspect window putty on outside of glass panes and replace if needed.
Lubricate door hinges and tighten screws as needed.
Lubricate garage door hardware and ensure it is operating properly.
Lubricate automatic garage door opener motor, chain, etc. and ensure that the auto-reverse mechanism is properly adjusted.
Check and replace damaged caulking and weather-stripping around windows and doorways, including the doorway between the garage and the house.
Inspect electrical service lines for secure attachment where they enter your house, and make sure there is no water leakage into the house along the electrical conduit.
Check exterior wood siding and trim for signs of deterioration; clean, replace or refinish as needed.
Check for and seal off any holes in exterior cladding that could be an entry point for small pests, such as bats, squirrels.
Remove any plants that contact, or roots that penetrate the siding or brick.
Climb up on your roof, or use binoculars, to check its general condition, and note any sagging, that could indicate structural problems requiring further investigation from inside the attic. Note the condition of all shingles for possible repair or replacement, and examine all roof flashings, such as at chimney and roof joints, for any signs of cracking or leakage.
Sweep chimneys connected to any wood burning appliance or fireplace, and inspect them for end-of-season problems.
Check the chimney cap and the caulking between the cap and the chimney.
Repair driveway and walkways as needed.
Repair any damaged steps that present a safety problem.